



LENCO SKI BOAT & TOW BOAT ACTUATOR REPLACEMENT REFERENCE GUIDE



FINDING YOUR Lenco MARINE REPLACEMENT ACTUATOR

REVISED MAY 2017

Follow these simple steps to find your 12 Volt Replacement Actuator

A

Find the code on face of the actuator below the Lenco label. The second digit from the left identifies the Actuator Type. Follow the arrow from step A on the chart below.

B


The first digit to the left represents either 3 or 5 lobes in the motor. 1-4 from code = 3 Lobes 5-8 from code = 5 Lobes Follow the arrow from step B on the chart below.

C

The last digit to the far right of the code identifies the hole size(s) for mounting. Follow the arrow from step C on the chart below.

The additional space is the only difference found between the old & new 5 digit code.

OLD BRANDING CODE (5 digit code used prior to 2013)

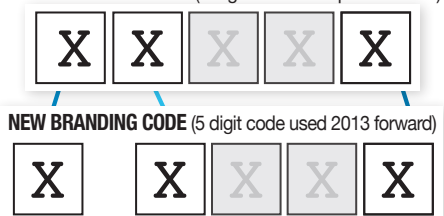

Location of the imprinted branding code [xxxxx] or [x_xxxx]



Your existing actuator

Actuators include 6' wire leads & Deutsch connectors (except for 15130-001).

Replacement Part #	OEM #	Type code	Lobes code	Hole code	Actuator	Stroke Length	Voltage	Wire Length	Top Hole	End Hole
N/A **	20400-0013	A	1-4	1	101 Standard	2.25"	12V	6'	5/16"	5/16"
15054-001	20400-001	A	5-8	1	101 Standard	2.25"	12V	6'	5/16"	5/16"
N/A **	20401-0013	C	1-4	2	101XD	2.25"	12V	6'	5/16"	5/16"
15055-001	20401-001	C	5-8	2	101XD	2.25"	12V	6'	5/16"	5/16"
15117-001**	20402-0013	E	1-4	2	101XDS	2.25"	12V	6'	5/16"	5/16"
15057-001	20402-001	E	5-8	2	101XDS	2.25"	12V	6'	5/16"	5/16"
15058-001	20402-002	E	5-8	3	101XDS	2.25"	12V	6'	3/8"	3/8"
15152-001	20402-013	E	5-8	4	101XDS	2.25"	12V	2'	5/16"	3/8"
15139-001	21145-001	ZA	5-8	2	101XDS (Fast) ***	2.25"	12V	6'	5/16"	5/16"
15059-001	20403-001	F	5-8	1	102S	4.25"	12V	6'	5/16"	5/16"
N/A **	20740-0023	L	1-4	1	1.25 Standard	1.25"	12V	6'	5/16"	5/16"
15132-001	20740-002	L	5-8	1	1.25 Standard	1.25"	12V	6'	5/16"	5/16"
15129-001	20990-001	V	5-8	1	102F (Fast) ***	4.25"	12V	6'	5/16"	5/16"
15118-001**	20791-0013	P,I,J	1-4	2	102HD	4.25"	12V	6'	5/16"	5/16"
15060-001	20791-0015	P,I,J	5-8	2	102HD	4.25"	12V	6'	5/16"	5/16"
15153-001	20791-003	P,I,J	5-8	4	102HD	4.25"	12V	6'	5/16"	3/8"
15119-001**	20740-0013	T*,L	1-4	2	1.25 XDS	1.25"	12V	6'	5/16"	5/16"
15120-001	20740-001	T*,L	5-8	2	1.25 XDS	1.25"	12V	6'	5/16"	5/16"
15121-001**	20740-003	N,L	1-4	4	1.25 XDS	1.25"	12V	6'	5/16"	3/8"
15122-001	20740-0035	N,L	5-8	4	1.25 XDS	1.25"	12V	6'	5/16"	3/8"
15130-001	20991-011	W	5-8	2	102 HD (Fast) ***	4.25"	12V	2'	5/16"	5/16"

* If your Malibu actuator contains the letter T in the branding code call Lenco Marine Customer Service at (772) 288-2662.

** This (3) lobe actuator is discontinued and no longer available. Please refer to the (5) Lobe Actuator Upgrade Conversion Guide to identify replacement products for older boats with (3) lobe actuators. For more information please contact Lenco Customer Service at (772) 288-2662. All (3) lobe actuators were manufactured 2011 and prior. All (5) lobe actuators were manufactured 2012 and later.

*** For direct replacement only.

Ski / Tow Boat	Actuators used
Correct Craft / Nautique	15060-001, 15057-001, 15139-001
Calabria	15117-001, 15057-001
Epic Boats	15117-001 (Center), 15057-001 (Center), 15060-001 (Surf)
Fineline / Ski Centurion	15119-001 (Center), 15120-001 (Center), 15055-001 (Center), 15060-001
Malibu / Axis	15118-001 (PW), 15060-001 (PW), 15059-001 (Surf Gate), 15129-001 (Surf Gate)
MasterCraft	15117-001, 15057-001, 15119-001, 15120-001, 15060-001, 20401-0013 (OEM#), 15055-001, 15152-001, 15153-001
MB Sports / TOMCAT / B52	15117-001, 15057-001
Skier's Choice / Supra / Moomba	15121-001, 15122-001, 15130-001, 15058-001
Tige	20400-0013 (OEM#), 20740-0023 (OEM#), 15054-001, 15132-001, 15057-001

OEM Quick Reference